

Work Permit # <u>DRL-2012- 024</u> Work Order

WORK O	ruer#
Job#	Activity#

See "Instructions for Filling out the Work Permit" contained in the Work Planning and Control for Experiments and Operations Subject Area. 1. Work request WCC fills out this section. ☐ Standing Work Permit Dept/Div/Group: PO/PHENIX Requester: Don Lynch Date: Ext.: 2253 Other Contact person (if different from requester): Carter Biggs Ext.: 7515 Work Control Coordinator: Don Lynch Start Date: 09/07/2012 Est. End Date: 12/01/2012 Brief Description of Work: Equipment: VTX/FVTX Coolant Room: PHENIX IR, AH Service Provider PHENIX Support Staff Building: 1008 2. WCC, Requester/Designee, Service Provider, and ESS&H (as necessary) fill out this section or attach analysis **ESS&H ANALYSIS** None Airborne Contamination Other **Radiation Concerns** Activation Radiation Special nuclear materials involved, notify Isotope Special Materials Group Fissionable/Radiological materials involved, notify Laboratory Nuclear Safety Officer Radiography Soil Density Gauges Radiation Generating Devices: ☐ Moisture Density Gauges ☐X-ray Equipment Safety and Security Concerns Explosives ☐ Transport of Haz/Rad Material Pressurized Systems □ None Railroad Work ☐ Adding/Removing Walls or Roofs Critical Lift ☐ Fumes/Mist/Dust* ☐ Cryogenic ☐ Heat/Cold Stress ■ Nanomaterials/particles* Rigging ☐ Asbestos* ☐ Beryllium* ☐ Electrical ☐ Hydraulic ☐ Noise* ☐ Silica* ☐ Biohazard* ☐ Elevated Work ☐ Lasers* ■ Non-ionizing Radiation* ☐ Security Concerns ☐ Chemicals/Corrosives* ☐ Excavation ☐ Lead* ☐ Oxygen Deficiency* ☐ Suspect/Counterfeit Items ☐ Penetrating Fire Walls ☐ Confined Space* ☐ Ergonomics* Vacuum * Safety Health Rep. Review Required Haz, Rad, Bio Material Exceed DOE 151.1-C Levels - Contact OEM Other **Environmental Concerns** None ☐ Work impacts Environmental Permit No. Land Use Institutional ☐ Atmospheric Discharges (rad/non-rad) ☐ Soil Activation/contamination □ Waste-Mixed Controls ☐ Liquid Discharges ☐ Chemical or Rad Material Storage or Use ☐ Waste-Clean ☐ Waste-Radioactive Oil/PCB Management Cesspools (UIC) □ Waste-Hazardous ☐ Waste-Regulated Medical ☐ High water/power consumption ☐ Spill potential ☐ Waste-Industrial ☐ Underground Duct/Piping Waste disposition by: ☐ Other Pollution Prevention (P2)/Waste Minimization Opportunity: No ☐ Yes **FACILITY CONCERNS** ☐ Intermittent Energy Release Potential to Cause a False Alarm ☐ Electrical Noise ☐ Vibrations ☐ Access/Egress Limitations ☐ Impacts Facility Use Agreement ☐ Temperature Change Other ☐ Maintenance Work on Ventilation Systems ☐ Configuration Management **Utility Interruptions** WORK CONTROLS **Work Practices** ■ None Exhaust Ventilation ☐ Lockout/Tagout ☐ Spill Containment ☐ Security (see Instruction Sheet) □ Back-up Person/Watch ☐ HP Coverage ☐ Posting/Warning Signs ☐ Time Limitation ☐ Barricades ☐ IH Survey ☐ Scaffolding-requires inspection ☐ Warning Alarm (i.e. "high level") ☐ Electrical Inspection Required Personal Protective Equipment ■ None Ear Plugs ⊠ Gloves as appropriate
 ☐ Lab Coat ☐ Safety Harness ☐ Coveralls ☐ Ear Muffs Respirator* Goggles ☐ Disposable Clothing ☐ Shoe Covers Safety Shoes ☐ Face Shield ☐ Hard Hat ☐ High visibility cloths/vest Other **Permits Required** (Permits must be valid when job is scheduled.) None ☐ Cutting/Welding ☐ Impair Fire Protection Systems ☐ Digging/Core ☐ Concrete/Masonry Penetration Rad Work Permit-RWP No Drilling ☐ Electrical Working ☐ Confined Space Entry ☐ Other Hot Dosimetry/Monitoring ☐ Heat Stress Monitor ☐ Real Time Monitor ☐ TLD for work in tunnels None ☐ Air Effluent ■ Noise Survey/Dosimeter ☐ Self-reading Pencil Dosimeter ☐ Waste Characterization O₂/Combustible Gas ☐ Ground Water ☐ Self-reading Digital Dosimeter ☐ Other ☐ Liquid Effluent Passive Vapor Monitor Sorbent Tube/Filter Pump Training Requirements (List specific training requirements) CA User or CA Access & PHENIX Awareness, Other skills training as appropriate Based on analysis above, the Review Team determines the risk, complexity, and If using the permit when all hazard ratings are low, only the following need to sign: (coordination ratings below: Although allowed, there is no need to use back of form) ESS&H Risk Level: ☐ Moderate ☐ High WCC: Date: Complexity Level: □ Low ☐ Moderate ☐ High Service Provider: Date: **Work Coordination:** □ Low Moderate ☐ High Authorization to start Date: (Department/Division, or their equivalent, Sup/WCC/Designee)

		ifications, and personnel availability need to be		
Special Working Conditions Required	(e.g., Industrial Hygiene hold point	s or other monitoring)		
None				
Notifications to operations and Operati	ional Limits Requirements: None			
Post Work Testing, Notification or Doc	umentation Required:			
Job Safety Analysis Required: Ye	es ⊠ No	Review Done: 🛛 in serie	es 🔲 team	
that could impact ESS&H have been of	considered and controls established	m members were appropriate for the work that value according to BNL requirements. In addition, the have been identified and recorded on this perm	nis signature indicates that applica	
<u>Title</u>	Name (print)	<u>Signature</u>	Life #	Date
ES&H Professional				
F&O Facility Project Manager				
Service Provider				
Work Control Coordinator	Don Lynch		20146	
Safety Health Representative				
Research Space Manager				
Other				
Other (PHENIX Escort)				
Required Walkdown Completed				
*Primary Reviewer	<u> </u>			
permit is current/complete. Job Super	erforming work have read and und	ection. erstand the hazards and permit requirements (in ures also includes verification that worker training Contractor Supervisor:		
Job Supervisor:	Life#:	Workers :	Life#:	
Workers:	LIIG#.	AAOIVQI2 .	LIIG#.	
Workers are encouraged to provide fee	L edback on FSS&H concerns or on	ideas for improved job work flow. Use feedback	k form or space below.	
Workers are choosinged to prome	Juddon on Leader doniesting at 1	luddo for improvou job work nom	N IOIIII OI OPUGG SGIGI	
5. Department/Division, or their	r equivalent, Line Manager	or Designee		
Conditions are appropriate to start wor	k: (Permit has been reviewed, wo	rk controls are in place and site is ready for job.		
Name:	Signature:	Life#:	Date:	
6. Worker provides feedback.				
Worker Feedback (use attached she	ets as necessary)			
a) WCM/WCC: Are there an	y changes as a result of worker fe	edback? Yes No		
Note: See Work Planning and Control	for Experiments and Operations S	Subject Area section 2.6		
7. Post Job Review/Closeout: Vacceptable condition. (WCC car	Work Control Coordinator (aเ n delegate clean up of job sit	ithorizing dept.) checks quality of competo work supervisor.) The WCC ensure		
postings, procedures, etc., is initial Name:	Signature:	Life#:	Date:	
Comments:	olghature.	LIIO#.	Date.	

VTXFVTX Coolant Piping Upgrade

INTRODUCTION

The VTX and FVTX PHENIX detector subsystems share a common support structure and cooling system which has been operating for several years with NOVEC 7200 as the coolant. The current system employs chillers, filters and a closed system with stainless steel piping. At the detectors, flow meters and TYGON tubing are used to distribute and apportion the coolant to the various internal cooling flow passages.

The system as currently configured operates at the limit of its capacity. In order to reduce restrictions within the piping system and accordingly increase the overall flow in the system thereby increasing all local flows within the detector, The following steps have been proposed:

- Decrease the inertial pressure losses by reducing the number of fittings and bends
- Decrease frictional losses by reducing piping lengths
- Reduce the lengths of flexible lines
- Improve the manifolding at the detector.

In addition, more instrumentation on both the chilled water and coolant sides of the chillers are to be added to improve fault reliability of operation and detection of abnormal conditions.

It is planned to upgrade the existing cooling system to this improved system design during the 2012 summer shutdown.


Procedures

All work described herein shall be coordinated and performed by PHENIX technicians and PHENIX cooling/gas system experts. In addition to standard training requirements (PHENIX Awareness and C-A User Training), all working personnel shall have appropriate skills and training to accomplish the work described herein. All workers shall have and wear the appropriate personal protective equipment (PPE) for each task.


- 1. All piping and fittings shall be thoroughly cleaned dried prior to installation. All cut segements of piping shall be thoroughly cleaned and deburred at the cut edges.
- 2. Piping shall be run as efficiently and directly as possible in accordance with the attached illustrations. (Worker planned work). Care shall be taken to locate piping so as to minimally interfere with access to and/or the operation, maintenance, testing, etc. of the RPC3 subsystem other systems and/or equipment. Piping shall be routed so as to preclude any creation of tripping hazards, inefficient use of space, intrusion into required clearances, etc.
- 3. After installation, piping shall be thoroughly leak tested.
- 4. Upon completion of installation all tools, consumable, materials, waste products, etc. shall be thoroughly cleaned from the site such that the site is restored to its pre-

installation state.


- 5. PHENIX cooling system experts shall install the operational components at the chillers and the detector and perform operational tests as appropriate to demonstrate specified operational characteristics.
- 6. Upon completion of this project, all work permit paperwork shall be completed, all unexpected problems and their solutions shall be recorded along with any other appropriate observations.

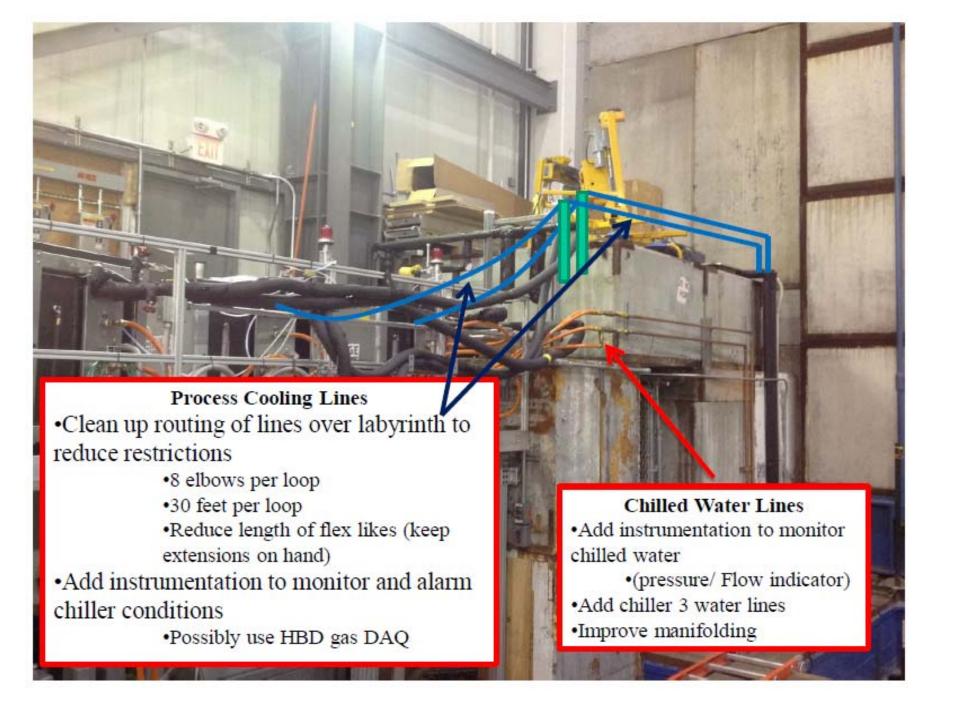

Side view/ one loop shown

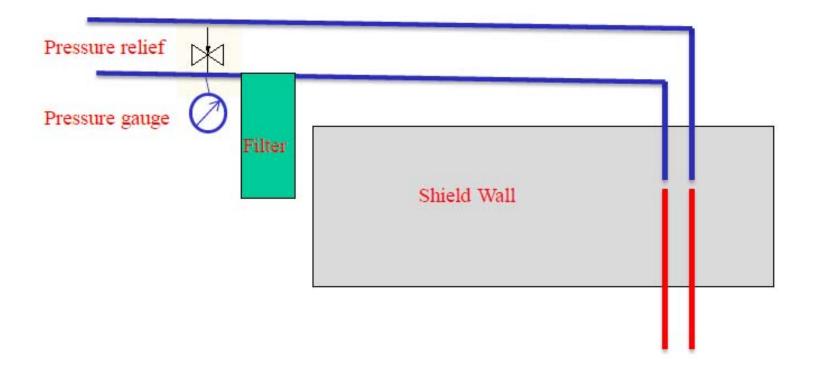

Top view

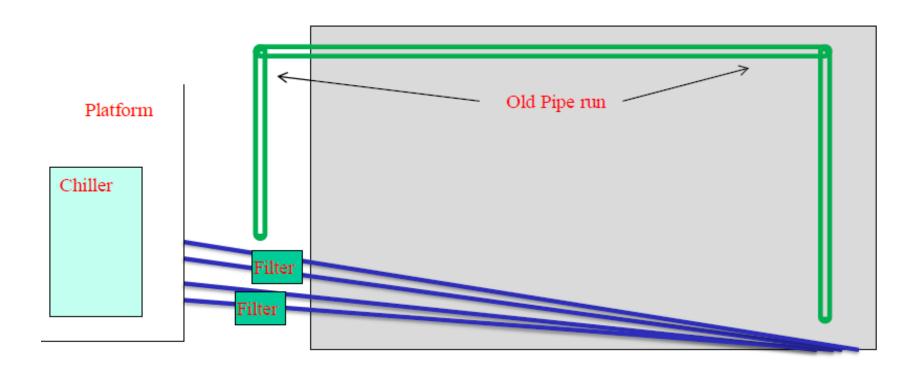


Replace nylon reinforced hose with stainless flex

Chiller Work


- •Replace nylon reinforced hose with stainless flex (2 per Chiller)
- •Bring in vendor to do maintenance on units




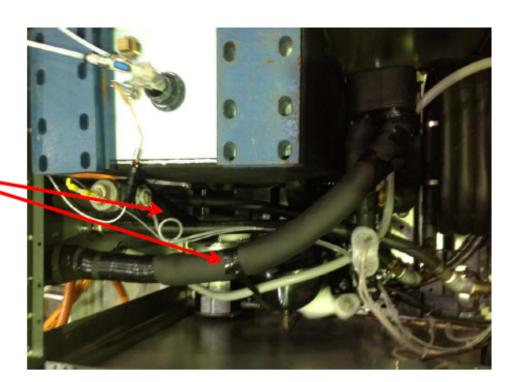



Upgrade Novec Cleaning System

- Install filters for both loops
- •Run insulated stainless lines from chillers to filters (DONE)

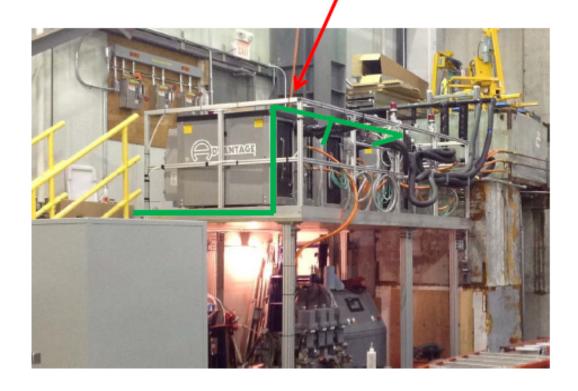

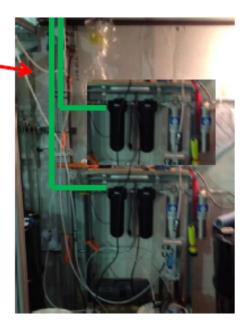


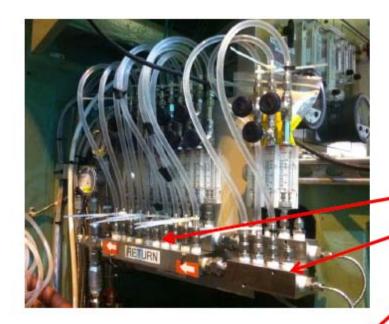

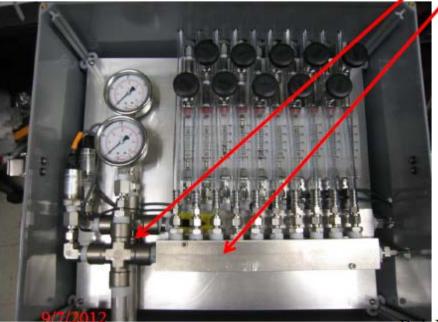

Manifolds in the IR

- •Big Wheel/ Low temp chiller
 - •Rebuild to increase size of manifold
 - ·make pixel lines permanent
- •Low Temp (possible)
 - Split North FVTX feeds
 - •Upgrade to 3/4" pipe from 1/2" where possible
 - •Increase size of manifold to reduce restrictions
- Nitrogen
 - ·Add more lines for FVTX feeds

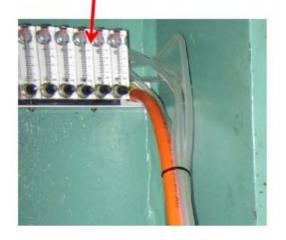

Rob Pisani